



## Technical Service Bulletin

Use of oversized lock washers on the clutch mounting bolts of these trucks with 12-inch clutches can cause release problems. The larger diameter of the washers can extend through the cutouts in the clutch far enough to contact the disc.

### **Affected Applications**

Item	Application	Item
1969-1979	Checker Deluxe, Marathon V8 5.7L 350"	04-064
1977-1984	Chevrolet Full Size Truck 1977-1984 V8 5.0L 305"	04-064
1967-1968	Chevrolet Full Size Truck 1967-1968 V8 5.4L 327"	04-064
1955-1959	Chevrolet Full Size Truck 1955-1959 V8 5.7L 348"	04-064
1979-1991	Chevrolet Full Size Truck 1979-1979 V8 5.7L 350"	04-064
1962-1967	GMC Full Size Truck 1962-1967 V8 4.6L 283"	04-064
1977-1984	GMC Full Size Truck 1977-1984 V8 5.0L 305"	04-064
1979-1991	GMC Full Size Truck 1979-1979 V8 5.7L 350"	04-064
1980-1987	GMC Medium Truck C40, C50, C60, C70 1980-1982 V6 4.8L 292"	04-064
1979-1989	GMC Medium Truck C40, C50, C60, C70 1979-1989 V8 5.7L 350"	04-064
1969-1971	Dodge Full Size Truck 1969-1971 V8 6.3L 383"	05-062
1972-1981	Dodge Full Size Truck 1972-1981 V8 6.6L 400"	05-062
1972-1978	Dodge Full Size Truck 1972-1978 V8 7.2L 440"	05-062

Use only standard 3/8-inch diameter lock washers or thread locking compound and torque the bolts to manufacturers' specifications.

