




Technical Service Bulletin

Premature clutch wear may be caused by insufficient clearance between the bell housing and slave cylinder. The slave mounting surface is located too far forward, restricting movement. This prevents proper fork movement, causing partial release and slippage.

Install a shim, Jeep part #4797072, between the slave cylinder and bell housing to avoid premature wear.

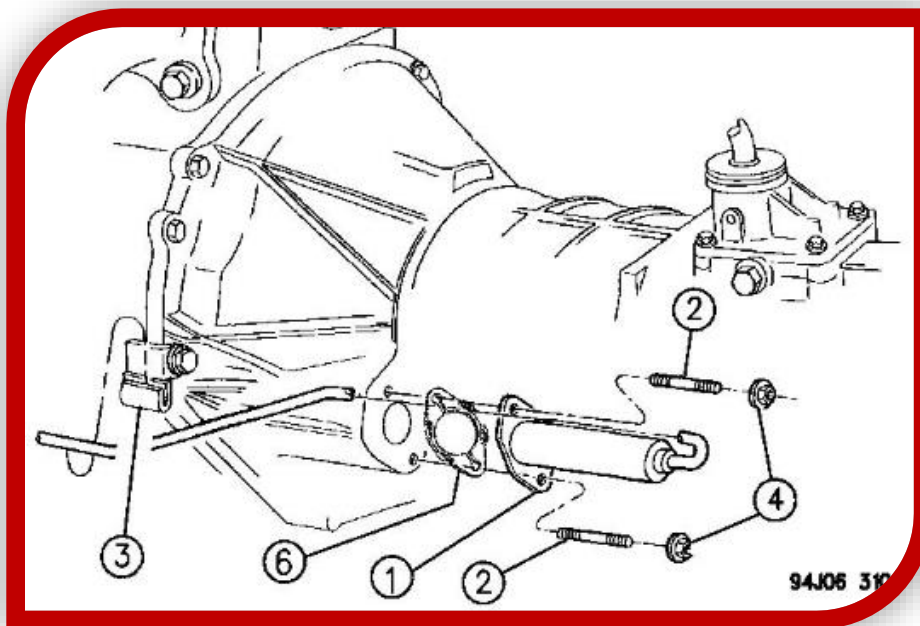

Item 6 is Jeep shim 4797072

Affected Applications:

Year	Make	Model	Engine
1994-1998	Jeep	Cherokee	4 Cyl 2.5L 150"
1994-1998	Jeep	Cherokee	6 Cyl 4L 242"
1994-1998	Jeep	Grand Cherokee	4 Cyl 2.5L 150"
1994-1998	Jeep	Grand Cherokee	6 Cyl 4L 242"
1994-1998	Jeep	Wrangler	4 Cyl 2.5L 150"
1994-1998	Jeep	Wrangler	6 Cyl 4L 242"

** For additional information, refer to Chrysler bulletin #06-03-94.*