




Technical Service Bulletin

Referenced vehicles were prone to no release, caused by a defective hydraulic release system. To eliminate leaks that may cause this condition, install an upgraded master cylinder and slave cylinder. These components must be installed together. Contact your distributor for specific part numbers.

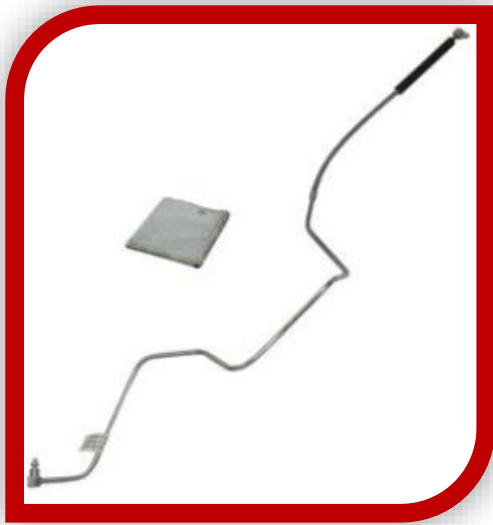

Ford part #F5TZ-7A512-A



Ford part #E7T2-7A554-A

A new tube kit, Ford part #F5TZ-7A512-A, and pedal pivot shaft lever, Ford part #E7T2-7A554-A, must be used with the upgraded parts.

Affected Applications:

Year	Make	Model	Engine
1993-1995	Ford	F-250, F-350	8 Cyl 7.3L 446"
1993-1995	Ford	F-450	8 Cyl 7.3L 446"
1993-1995	Ford	F-250, F-350	8 Cyl 7.5L 460"
1993-1995	Ford	F-450	8 Cyl 7.5L 460"

****For additional information, refer to Ford bulletin #95-4-9.***