


## Technical Service Bulletin

Insufficient lubrication between the fork and the ball stud may be misdiagnosed as a release bearing problem. Light pressure on the clutch pedal will silence the noise temporarily. Lubrication of the pivot ball-to-fork contact will eliminate the problem. To speed up future lubrication, install a grease fitting.

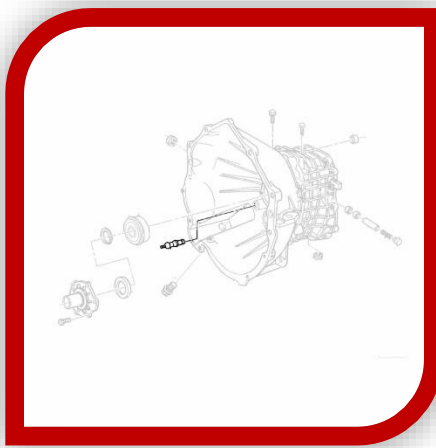

The 1984- S- and T- Series with Borg-Warner 5-speed transmissions (ML2, ML3, MW1) require a pre-drilled pivot ball and matching release fork. Locate the raised boss on the outside of the bell housing that is directly in-line with the center of the pivot ball mounting hole. Drill a hole through the center line of the boss into the pivot ball mounting hole and tap the hole for installation of a 1/8-inch NPT grease fitting. Lubricate the pivot ball and reinstall the transmission with a pipe plug instead of a grease fitting. This will prevent over-lubrication of the pivot stud during normal maintenance.

### **Affected Items:**

Year	Make	Engine	Part Number
1994-1995	Chevrolet, General Motors Truck	4 Cyl 2.2L	04-138
1984-1993	Chevrolet, General Motors Truck	4 Cyl 2.5L	04-130
1990-1991	Chevrolet, General Motors Truck	4 Cyl 3.9L	04-140
1983-1984	Chevrolet, General Motors Truck	6 Cyl 2.8L	04-069
1985-1993	Chevrolet, General Motors Truck	6 Cyl 2.8L	04-130
1985-1991	Chevrolet, General Motors Truck	6 Cyl 4.3L	04-089
1992-1995	Chevrolet, General Motors Truck	6 Cyl 4.3L	04-121
1985-1989	Chevrolet, General Motors Truck	6 Cyl 4.8L	04-081
1985-1987	Chevrolet, General Motors Truck	8 Cyl 5.0L	04-081
1988-1995	Chevrolet, General Motors Truck	8 Cyl 5.0L	04-121
1981-1991	Chevrolet, General Motors Truck	8 Cyl 5.7L	04-064
1981-1991	Chevrolet, General Motors Truck	8 Cyl 5.7L	04-064HD
1991-1995	Chevrolet, General Motors Truck	8 Cyl 5.7L	04-122
1985-1989	Chevrolet, General Motors Truck	8 Cyl 6.2L	04-087
1990-1993	Chevrolet, General Motors Truck	8 Cyl 6.2L	04-122
1992-1995	Chevrolet, General Motors Truck	8 Cyl 6.5L	04-131
1994-1995	Chevrolet, General Motors Truck	8 Cyl 6.5L	04-122
1991-1995	Chevrolet, General Motors Truck	8 Cyl 7.4L	04-535

\* For additional information, refer to GM bulletin #16-73-01.

\*For specific information on the procedure for 1994-95 C/K and S/T Series, refer to GM bulletin #56-73-01