




## Technical Service Bulletin

When replacing the clutch fork on Dodge truck applications, the part can be installed incorrectly by mistake if careful attention is not paid. If the fork is installed incorrectly, there will likely be a no release condition, as a result.

1 – Pivot (Ball Stud)
2 – Clutch Fork
3 – Slave Cylinder
4 – Release (Throwout) Bearing
5 – Slot in Fork

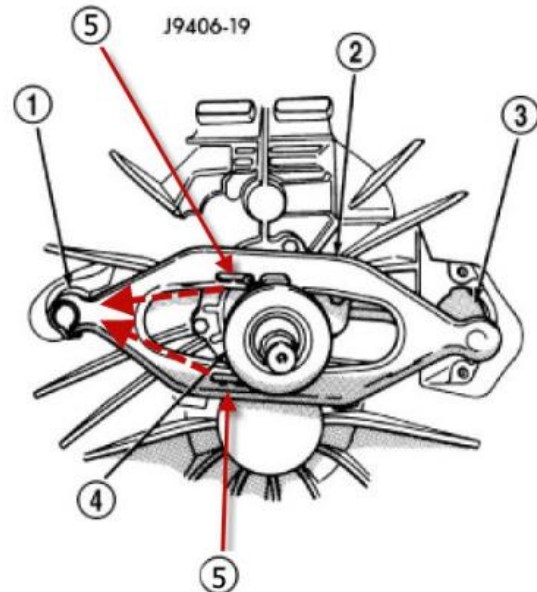

The clutch fork must be installed with the slots of the fork pointed toward the Pivot (Ball) Stud side of the bellhousing.

### **Applications Affected:**

Year	Make	Model	Engine
1994-2010	Dodge	2500, 3500	6 Cyl 5.9L
2007-2010	Dodge	2500, 3500	6 Cyl 6.7L
2011-2016	Ram	2500, 3500	6 Cyl 6.7L
2012-2018	Ram	4500, 5500	6 Cyl 6.7L
1994-2003	Dodge	2500, 3500	10 Cyl 8.0L